

TAW_ID	TAW_PRIORITY	TAW_TYPE_DESC	TAW_STAT_DESC	WO_NBR	WO_TSK	EQUIP	TAW_DESC	EST_AMT	ACT_AMT	ORIG_ID	EDIT_LOCK
16433		TAW (DISC)	DENIED			F-1100B	Denied - added after plant turned over.  F-1100B Upper right convection door hinge was found broken during closure inspection. The door can be closed and spot welded in place.	\$0.00	\$0.00	MLEM	0
16432		TAW (DISC)	DENIED			F-1100A	Denied - added after plant turned over.  F-1100A Upper radiant u-bend door hinges (2) were found broken during closure inspection. Door can be closed and hinges spot welded in place.	\$0.00	\$0.00	MLEM	0
16344		TAW (DISC)	DENIED	DENIED	000	DENIED	Denied this valve covered under TAW 16299 Broken stem on welded bonnet 3/4" bleeder  DENIED this valve covered under TAW 16299  3/4" Bleeder valve on E-1115 has a broken stem with a welded bonnet and needs to be scarfed out and replaced.	\$0.00	\$0.00	MFES	0
16343		LATE	DENIED	DENIED		42LV026	Denied - SMBD 11/3/11 Valve can be replaced outside of TA.  At DEBRU surge boxes The 3" 150# globe valve on the 42LV026 bypass has a broken stem and needs to be replaced.	\$0.00	\$0.00	MFES	0
16319		TAW (DISC)	DENIED	DENIED		DENIED	OTR per ABU, not needed for startup.  DENIED 2" Block valve @ base of K-1196 to relief broken. Need to replace with in-kind 2" 150 psi	\$0.00	\$0.00	ACRZ	0
16297		TAW (DISC)	DENIED	313079	02	VALVES	Bay valve fixed. Waiting to see if bay valve can fix  NOT DOING (--) BE-102-E4 REVISION 1 / EXTRA VALVES REVISION  VALVE TAG #105 & 106 WERE FOUND TO NOT BE ABLE TO BE REPAIRED BY BAY VALVE. VALVES WILL NEED TO BE REPLACED.	\$0.00	\$0.00	PMGR	0
16273		LATE	DENIED	DENIED		DENIED	Discussed with Dave Curry and this can be isolated for work on the run. ADTK 10/29  DENIED Steam tracing at plot limit on 8 s/c to RLOP is isolated for work on EWO BE-138. The steam tracing leaks badly and can be replaced while this line is down for w	\$0.00	\$0.00	MFES	0
16257		TAW (DISC)	DENIED	DENIED		DENIED	Denied - too late. Curry said can do OTR  DENIED 4CU EXTRA VALVE REPAIR E-1108 ABCR Inlet Bleeder Valve; 3/4" Gate welded; leaks by; System 12 K-1171 1st Stage knock-out; 1" gate valve welded; stuck open & handwheel stripped; System 10 K-1100B 2nd St	\$0.00	\$0.00	KCSO	0
16241		TAW (DISC)	DENIED	DENIED		DENIED	Denied, need a redesign next T/A.  F-1100B North and South Cell 2" SS Snuffing Steam nozzles (8 total) have corroded to failure. Use of these nozzles in the current condition will continue to deteriorate the refractory. Lack of refractory and hot spots	\$0.00	\$0.00	MLEM	0
16240		TAW (DISC)	DENIED	DENIED		DENIED	Need a redesign next T/A  F-1100A North and South Cell 2" SS Snuffing Steam nozzles (8 total) have corroded to failure. Use of these nozzles in the current condition will continue to deteriorate the refractory. Lack of refractory and hot spots can resul	\$0.00	\$0.00	MLEM	0
16239		TAW (DISC)	DENIED	DENIED		DENIED	Need a redesign next T/A  F-1160 North and South Cell 2" SS Snuffing Steam nozzles (8 total) have corroded to failure. Use of these nozzles in the current condition will continue to deteriorate the refractory. Lack of refractory and hot spots can result	\$0.00	\$0.00	MLEM	0

16178		TAW (DISC)	DENIED	DENIED		DENIED	Denied - can do on the run, inside pump block valves  DENIED 0955-007-001 piping spool replacement  0955-007-001 piping spool replacement coming off the P-1149 pump. We are currently below refinery recommended replacement thickness and above DED prov nubbins are in workscope already, blend grind laminations duplicate of previous TAW.	\$0.00	\$0.00	TBEA	0
16159		TAW (DISC)	DENIED	DENIED		DENIED	DENIED Channel - remove nubbins  INFORMATION Machine off nubbins on both sides of the channel to a 250 RMS finish Blend the two de laminations into the alloy liner DENIED Channel repairs. Duplicate	\$0.00	\$0.00	DWCD	0
16158		TAW (DISC)	DENIED	DENIED		DENIED	INFORMATION The channel pass partition plate requires repair due to bowing and distortion/corrosion/thinning of the sealing edge. The top nozzle gasket surface requires re-machining to repair mechanical damage.  RE DENIED Missing fasteners on the skid bar. Duplicate	\$0.00	\$0.00	DWCD	0
16157		TAW (DISC)	DENIED	DENIED		DENIED	INFORMATION There are at least 2 missing fasteners on the skid bar assembly for the bottom of the bundle.  RECOMMENDATIONS Replace the missing fasteners for the bundle cage. The ½" diameter bolts DENIED Replace tie-rods/spacers duplicate	\$0.00	\$0.00	DWCD	0
16156		TAW (DISC)	DENIED	DENIED		DENIED	INFORMATION Two of the tie-rods / spacers are heavy corroded with sections completely worn away.  RECOMMENDATIONS Replace two (2) tie-rods / spacers in-kind. Inspected by John Halbert API 510 #662	\$0.00	\$0.00	DWCD	0
16122		TAW (DISC)	DENIED	DENIED	02	E-1160A	DED said no work needed.  DENIED BE449-E1 / 4CU / E-1160A Machine gasket seating surface  Machine gasket seating surface and partition trench on channel cover due to corrosion. Depths of corrosion up to 20 mils. 30 mils of machining required.  DED -	\$0.00	\$0.00	PCRD	0
16121		TAW (DISC)	DENIED	DENIED	02	E-1160B	Denied no work needed per DED  DENIED BE450-E1 / 4CU / E-1160B Machine gasket seating surfac  Machine gasket seating surface and partition trench on channel cover due to corrosion. Depths of corrosion up to 40 mils. 50 mils of machining required.  D	\$0.00	\$0.00	PCRD	0
16093		TAW (DISC)	DENIED	DENIED		DENIED	Job will be added to the TSS joblog and done on the run.  DENIED Add a low point bleeder on the K-1179/A drain line to pump out. Isometric Drawing 0955-036-B01. P&ID # D-308352-16	\$0.00	\$0.00	MFES	0

16051		TAW (DISC)	DENIED	DENIED		DENIED	Deny - not needed. DENIED Steam lines to V-1103 and vent line to relief to clean vessel for VDP.	\$0.00	\$0.00	ACRZ	0
15991		TAW (DISC)	DENIED	DENIED		DENIED	Already in Koch's scope. DENIED C-1160 / Bottom / Clean out sludge  Clean out sludge in the bottom section of C-1160 where Koch has already had scaffold erected. Denied per PED.	\$0.00	\$0.00	BPCQ	0
15990		TAW (DISC)	DENIED	DENIED		DENIED	DENIED C-1160 / Top Bed / Clean Scale  There is scale from the column shell sitting on top of the structured packing and in the distributor trough. The scale should be removed to prevent it from plugging up either the packing or the will do on the run. Will mark or tape off if safety hazard now.	\$0.00	\$0.00	BPCQ	0
15796		TAW (DISC)	DENIED	DENIED		DENIED	DENIED The decking is loose on C-1180. One whole side of deck(about 3.5ft) is sticking up about 3 in.. It needs to be welded down. Denied - MRG - 10/12/11. Can be done on the run and not a critical pump for startup.	\$0.00	\$0.00	MIEG	0
15786		WL (DISC)	DENIED	DENIED		DENIED	DENIED 4CU / P-1109A pump seal failed. Pull the pump bearing bracket only and send to the machine shop for a sel repair. A pump volute case cover will be need to is Denied - MRG 9/28/2011. Ops will try to clean without opening.	\$0.00	\$0.00	HOUE	0
15709		LATE	DENIED				DENIED V-1190 BOOT SIGHT GLASS REMOVAL	\$0.00	\$0.00	KCSO	0
15671		LATE	DENIED	DENIED		DENIED	Duplicae of TAW 15685 DENIED 5H2S / Add bleeders on line LPG line 0121-017-007B  Add bleeders on line LPG line 0121-017-007B to allow water to be drained after clean up. Existing EWO BK110-E1 will be revised to include this work.	\$0.00	\$0.00	MGCV	0